TPB741 APR 10 1231 EST <1228)(4-023029S100)PD 04/10/81 1229 ICS IPHRNGZ CSP 3129811000 MGH TDBN ELK GROVE VILLAGE IL 181 04-10 1229P EST

CARE J E WEATHERHEAD DISTRIBUTING LTD 4318 DAWSON ST **5** BURNABY BC CAN V5C 4B6

APR 13 1980]

ZARZON ZARZON

IT HAS BEEN BROUGHT TO OUR ATTENTION THAT SOME DISTRIBUTORS HAVE ABOVE UNIT IN THEIR SHOWROOM WITH CREDITS ON THE SCREEN AND THE GAME NOT IN THE APPROPRIATE ATTRACT MODE REPEAT NOT IN THE APPROPRIATE - $oldsymbol{\omega}$ attract mode. This eliminates to the prospective buyer the true ACTION AND PLAY APPEAL. RECOMMEND THAT ALL GAMES IN THE SHOWROOM BE . IN THE ATTRACT MODE ONLY REPEAT IN THE ATTRACT MODE ONLY AND CAN BE COINED WHEN BEING BEHONSTRATED.



ZARZON WAS DESIGNED SPECIFICALLY TO CHALLENGE PLAYERS OF EVERY SKILL LEVEL NOT ONLY THE NOVICE. THEREFORE, ONE OF THE MOST INPORTANT INGREDIENTS IS TO HAVE THE GAME IN THE ATTRACT HODE WHICH WILL INDICATE ALL OF THE GAME FEATURES AND SEQUENCES.

THE FACTORY HAS BEEN RECEIVING MANY CALLS FROM OPERATORS ALL OVER THE COUNTRY CONGRATULATING US ON NAKING AVAILABLE TO THEM A SKILLFUL SPACE GAME. XINDLY BE QUIDED ACCORDINGLY AND EXPECT TO RECEIVE YOUR COOPERATION AND SUBSEQUENT ORDER WHEN REQUESTED.

REGARDS

J H MITTEL, TAITO AMERICA CORPORATION



TAITO AMERICA CORPORATION

1256 ESTES AVENUE • ELK GROVE VILLAGE, IL 60007 (312) 981-1000 • TELEX 253290 CABLE TAMCO ELK GROVE VILLAGE

April 29, 1981

TO: ALL TAITO AMERICA CORPORATION DISTRIBUTORS

RE: ZARZON MANUALS

ENCLOSED YOU WILL FIND AMENDMENT PAGES FOR YOUR ZARZON
MANUALS. PLEASE KEEP TWO (2) FOR YOUR SERVICE DEPARTMENTS'
MANUALS AND DISTRIBUTE THE REMAINING (1 FOR EACH GAME YOU
HAVE RECEIVED) TO YOUR OPERATORS WHO HAVE PURCHASED ZARZONS.


TAITO AMERICA CORPORATION



AMENDMENTS

CONTROL PANEL

FIGURE 4

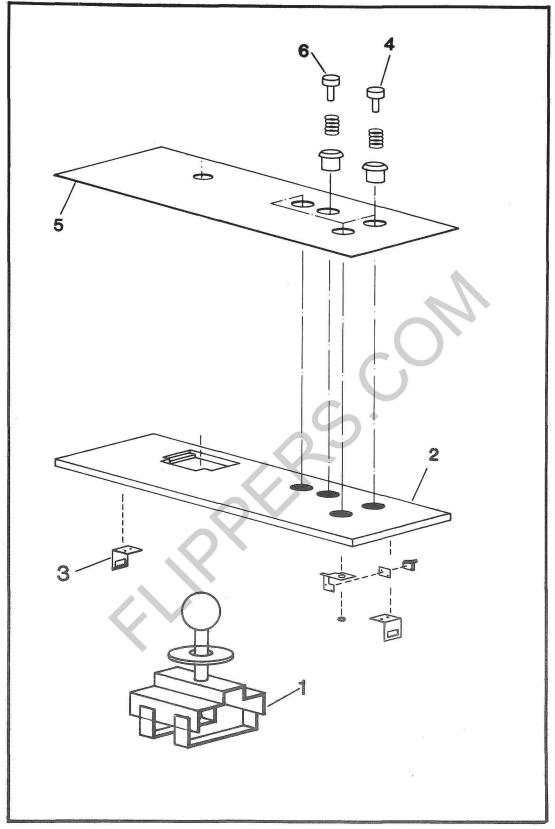

ITEM	TAITO PART NO.	DESCRIPTION	REFERENCE
1	29-00011-001	Joystick Assembly (2-way)	850084
2	42-00063-001	Control Panel Wood	
3	61A00015-001	Strike Hook	390003
4	29-00009-0013	Push Button Assembly (White)	BK00004
5	47B00008-001	Dash Panel, Screened	
6	29-00008-001	Push Button Assy (Red)	BKO 00003

SERVICE TIPS

FAST AID HOT LINE: 800-323-0666 EXCEPT ILLINOIS: 312-981-1000 Ext. 215 TELEX: 253290



☐ MANDATORY

81-6

ON FAILURE ONLY

FOR YOUR INFORMATION ONLY

ATTN: SERVICE MANAGER

GAME: ZARZON

SUBJECT: STATIC SOUND ON THE "GO TO SATURN" OR IT WILL STAY AT THE

LAST NOTE TO LONG

SOLUTION: RESISTOR CHANGE

PARTS NEEDED: ONE 33K OHM RESISTOR

DISPOSITION OF OLD PARTS: S

SCRAP

TAITO AMERICA CORPORATION
1256 Estes Ave., Elk Grove Village, IL 60007

PROCEDURE: WITH THE G CONNECTOR FACING YOU, DISCONNECT THE RIGHT LEG
OF R1 (SEE FIGURE 1). IF THAT FIXES THE PROBLEM, REPLACE IT
WITH A 33 OHM RESISTOR. IF IT DOES NOT FIX THE PROBLEM,
REPLACE IC17 (76477) CHIP.
SOME BOARDS HAVE A DIFFERENT NUMBERING SYSTEM, ON THOSE
BOARDS IT WOULD BE R60 AND IC55. THEY WOULD BE AT THE SAME
LOCATION.

FIGURE 1.

